City of Wichita, Kansas Americans with Disabilities Act Transition Plan

Maya Angelou Branch Library

3051 E. 21st Street

July 2005



Prepared by

DMCG

Disability Management Consulting Group L.L.C.

2801 Jonquil Place Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita - ADA/504 Transition Plan - Maya Angelou Branch Library - July 2005

Legend: Blue font identifies hyperlinked documents - Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high		Supplemental Technical Information			Finalized Actions			
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Exterior - Parking	Accessible parking spaces do not provide definitive demarcations (faded paint) to specifically determine width measurements.	4.1.2(5)(b), 4.6.3	Supplemental technical information pertaining to ADAAG recommends that accessible vehicle parking spaces and access aisle be demarcated (painted) to ensure appropriate clear widths exist. Stripe accessible vehicle parking areas and adjacent access aisles so that the width of each is clearly discernable ensuring that at least one van accessible parking space exists.	L H	Н	M	3	\$20	Accessible Parking Detail Access Board – Bulletin #4			
2. Exterior – Pedestrian Routes	Steps exist on the sidewalk, leading from 21 st Street.	4.3.2(2)	ADAAG does not allow steps to exist on any accessible path of travel. Ensure that an accessible pedestrian route exists from 21 st Street to the Library.	M	Н	M	1	\$1, 000	ADAAG			
3. Interior – Meeting Room	The clothes rod is located too high and is a protruding object.	<u>4.4</u> <u>4.25.3</u>	Where clothing racks are provided, at least one must comply with reach ranges defined by ADAAG 4.2.5 or 4.2.6. Install an additional coat rack at a maximum height of 54-inches or lower the existing rack so that one rack is a maximum of 54-inches. Provide a cane detectable area under the coat racks.	M	Н	M	<u>12</u>	\$10 0	Building Block 2 – 27" to 80" zone Building Block 10 – Reach Ranges			
4. Interior - Restrooms	Braille and raised character signage, located at both the men's and women's entrance doors, is in the wrong location.	4.1.3(16) 4.30.4	Signs that identify permanent rooms and spaces are required to be provided in Braille, mounted at 60-inches high measured to the center of the sign at the latch side, and located far enough away from the swing of the door so that a person can approach the sign within 3-inches and not be located in the swing of the door. Braille and raised letter signs exist at the restroom entrance door, but they are located on the doors, not at the latch side. Relocate the existing Braille signs to the latch side of entrance doors.	M	Н	M	<u>7</u> 9	\$25	Signage Specifications for Permanent Rooms and Spaces			
5. Interior - Restrooms	The interior of the men's restroom entrance door does not provide appropriate maneuvering space.	4.13.6	The interior of the existing entrance door provides less than 4-feet of clear floor space measured from the face of the door to the wall. ADAAG requires doors of this type to provide at least 54-inches of clear floor space in length and the width of the door plus 24-inches in total width (See ADAAG fig. 25(c). Modify this door to comply with ADAAG specifications by rehinging the door to swing outward, if it is technically feasible to do so.	M H	Н	M	11	\$1, 000	See Building Block 8 - Accessible Doors for more information regarding maneuvering space			

City of Wichita - ADA/504 Transition Plan - Maya Angelou Branch Library - July 2005

Legend: Blue font identifies hyperlinked documents - Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	М	Criteria – L=low, M=medium, H=high		L=low, =medium,		Supp	lemental Technical Information	Finalized Actions		
Location 6. Interior	Identified Issue All other aspects of the restrooms and the interior of this library are fully accessible and in compliance with ADAAG.	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	ncy - PWD		Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)		

Maya Angelou Branch Library - Conceptual Cost Projections

Total	\$2,325
Year One (Very High)	\$0
Year Three (High)	\$1,200
Year Five (Medium)	\$1,125
Year Ten (Low)	\$0

Note: The ® symbol lets users know that some risk may be involved regarding the particular structural barrier in question. The ADA Accessibility Guidelines (ADAAG) was developed to define what constitutes features of buildings or facilities considered to be accessible to individuals with various disabilities. However, many of the specifications found in ADAAG exist, not only to define accessible features, but also to define accessible features that can be utilized in a safe manner.